


Instruction Sheet

Ortronics Installation, UTP Cat 6A / Cat 6 / Cat 5e Field Term Plugs


①

Insert cable into strain relief boot, strip off 1.2 inch of cable jacket.

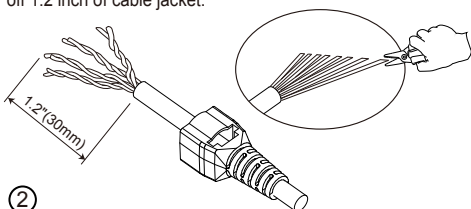

②

Fan out all four twisted pairs. With the attached wiring cap label facing up, insert the bottom row of conductors according to the indicated color code. Push the wiring cap back to the cable jacket and trim bottom conductors flush to cap end. Lace the remaining conductors into the top row of the wiring cap according to the indicated color code. Trim top conductors at location shown in illustration.

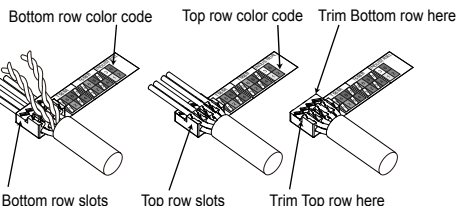


③

Rotate the conductor assembly into position with the wiring cap label facing down. Remove the wiring label from the cap and align the rear of the wiring cap with the opening pocket guides of the plug receptacle.


④

Place the wiring cap onto plug, use plier to clamp wiring cap until it completely snap-in to effect the connection.

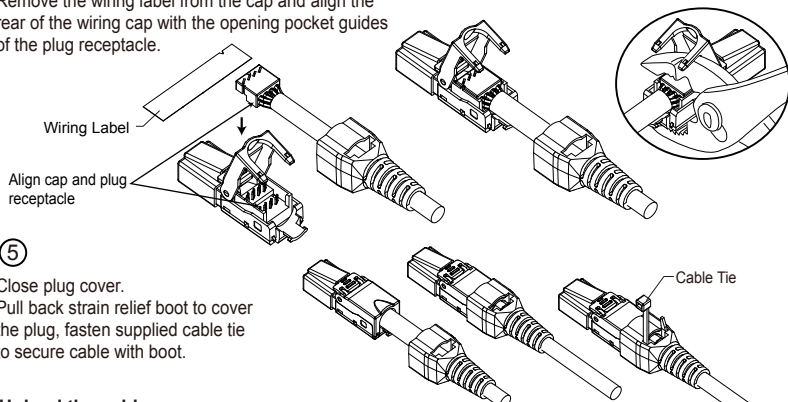


⑤

Close plug cover. Pull back strain relief boot to cover the plug, fasten supplied cable tie to secure cable with boot.

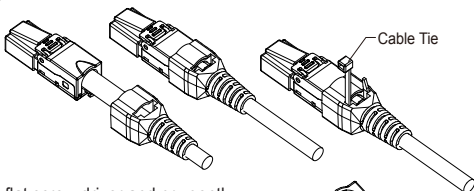

Unload the cable

Cut off cable tie, remove the boot. Using flat screw driver and pry gently on plug cover one end first and the other end subsequently to open it.

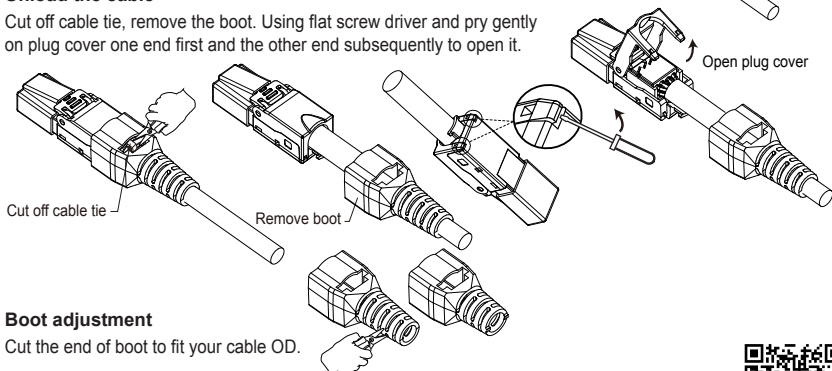

Boot adjustment

Cut the end of boot to fit your cable OD.

