

### Wiremold

## PK Preset Activation Kit with Extended Receptacle Bracket

INSTALLATION INSTRUCTIONS

Installation Instruction No.: 1 005 083R1 – Updated March 2010

Products Covered: WPACREXT Series & DTB-2EXT Series

NOTE: Refer to the current version of Installation Instruction 1 002 300 for instructions on locating Preset and installing Grommet.


#### **Power Feed from Side Compartment:**


- 1. Do not remove knockout from center compartment.
- 2. Pull electrical wires through grommet hole in side compartment.
- **3.** Remove knockout from receptacle housing and install bushing. Route wires through bushing and attach to Listed receptacle.
- **4.** Trim receptacle insulator to fit inside of housing and position over receptacle.
- Attach receptacle with insulator to receptacle housing with two #6-32 screws and nuts (not included). Place housing assembly in PK Insert and arrange wires to clear side closure.
- 6. Repeat steps 1 through 5 for other receptacle bracket.
- NOTE: Bracket must be installed even if second Receptacle is not required
- 7. fasten side closure (Cat. No. DTB-2EXT-B) to preset as shown.


**Wiremold** electrical systems conform to and should be properly grounded in compliance with requirements of the current National Electrical Code or codes administered by local authorities.

All electrical products may present a possible shock or fire hazard if improperly installed or used. Wiremold electrical products may bear the mark as UL Listed and/or Classified and should be installed in conformance with current local and/or the National Electrical Code.

# IMPORTANT: Please read all instructions before beginning.

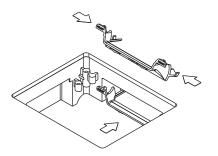


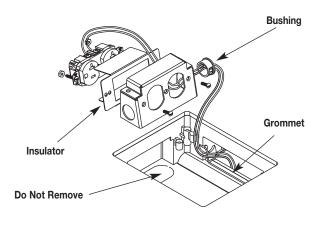


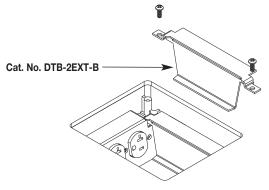

#### **Power Feed from Center Compartment:**

- NOTE: Install Receptacle Housing and Grommets as shown in the current version of Installation Instruction 1 002 300.
- 1. Do not remove knockout in side of receptacle housing.
- Communications Bracket Series DTB-2EXT may only be used on outboard cells designated for communication wiring, and only with WPACREXT Series Receptacle Housings.

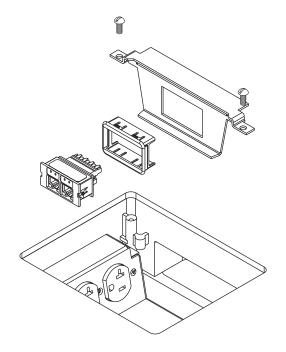

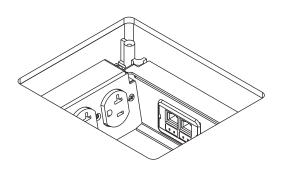





 Wiremold

 U.S. and International:

 60 Woodlawn Street • West Hartford, CT 06110

 1-800-621-0049 • FAX 860-232-2062 • Outside U.S.: 860-233-6251

 Canada:

 570 Applewood Crescent • Vaughan, Ontario L4K 4B4

 1-800-723-5175 • FAX 905-738-9721

23